Breathing Air Purity Test Kit



The Parker domnick hunter Breathing Air Purity Test Kit (APTK1) allows for a convenient 'on the spot' indication of compressed air quality. This comprehensive test kit is compact, easy to operate and can be used to indicate the level of contamination both upstream and downstream of purification equipment.

It is supplied complete with oil mist, water vapour CO and CO₂ test tubes to allow immediate multiple testing.

In addition to the detection of compressed air contaminants listed above, the APTK1 also features an Oxygen Analyser allowing for constant real-time display of the oxygen content within the compressed air system.

The APTK1 is not only suitable for industrial compressed air testing but also, the additional O_2 analysing feature enables compressed air lines that supply Breathing Air/ Respiratory Protection Equipment (RPE) to be tested to the latest national and international standards.



Contact Information:

Parker Hannifin Ltd domnick hunter Industrial division Dukesway, Team Valley Trading Estate Gateshead, Tyne and Wear England NE11 0PZ

Tel: +44 (0)191 402 9000 Fax: +44 (0)191 482 6296 Email: dhindsales@parker.com www.domnickhunter.com

Air Content Measurables:

- Oxygen
- CO
- CO₂
- Water Vapour
- Mineral Oil

Benefits:


- Lightweight and portable kit in a robust carry case
- Digital oxygen content monitoring
- Allows simultaneous testing of upstream and downstream air purity
- Testing quality of breathing air to national and international Standards
- Can be used with compressed air pressures up to 10 bar g (145 psi g)
- Factory set for use with 'Gastec Ltd' detection tubes





Technical Data

Air Purity Test Kit				
Maximum inlet pressure:	10 bar g (145 psi g)			
Analysis operating pressure:	3 bar g (43.5 psi g) - Factory set			
Maximum inlet temperature:	40°C (104°F)			
Minimum inlet temperature:	15°C (59°F)			
Flow accuracy:	±4% outlet			
Air flow rate range at outlet:	30 - 2500 cc/min			
Hose connections:	6mm -1/4 " push in adaptor			
Approved detector tubes:	Calibrated for: Gastec Ltd detector tubes			

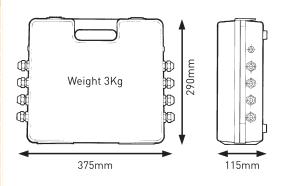

Air Contaminant / Content Analysis

Model	Measurable	Sample Rate	Test Duration	Total Volume
APTK1 (60 603 5050)	CO	100ml/min	1.5 minutes	150ml
	CO ₂	100ml/min	3 minutes	300ml
	Water Vapour	100ml/min	10 minutes	1 litre
	Oil Mist (Mineral)	100ml/min	60 minutes	60 litres
	Oxygen	50ml/min	Real-time display	n/a

Consumable Parts

Replacement Gas Detection Tubes / O ₂ Analyser				
Contaminant	Kit Part Number			
Carbon Monoxide (CO)	608200465			
Carbon Dioxide (CO ₂)	608200464			
Water Vapour (H ₂ O)	608200462			
Oil Mist	608200463			
O ₂ Analyser	606035300			

NB. All flow rates are factory set to allow immediate testing.

The Parker domnick hunter Air Purity Test Kit (APTK1) is supplied complete with oil mist, water vapour, CO and CO_2 test tubes (supplied in packs of 10) to allow immediate multiple testing.

		Compressed Air For Breathing - World Standards				
		Europe BS EN12021	USA 29 CFR 1910.134	Canada CSA Z180.1-00	Australia AS/NZS 1715 : 1994	
SUSTANCE	Oxygen	21% (±1%)	19.5% - 23.5%	20% - 22% BY VOLUME (DRY AIR)	19.5% - 22%	
	Carbon Dioxide	NOT MORE THAN 500ppm	NOT MORE THAN 1000ppm	NOT MORE THAN 500ppm	NOT MORE THAN 800ppm	
	Carbon Monoxide	NOT MORE THAN 15ppm	NOT MORE THAN 10ppm	NOT MORE THAN 5ppm	NOT MORE THAN 10ppm	
	Oil Mist / Vapour	NOT MORE THAN 0.5mg/m ³	NOT MORE THAN 5ppm	NOT MORE THAN 1mg/m ³	NOT MORE THAN 1mg/m ³	
	Odour / Taste	WITHOUT SIGNIFICANT ODOUR OR TASTE	WITHOUT SIGNIFICANT ODOUR OR TASTE	WITHOUT SIGNIFICANT ODOUR OR TASTE	WITHOUT SIGNIFICANT ODOUR OR TASTE	
	Water (liquid)	THERE SHOULD BE NO FREE WATER	THERE SHOULD BE NO FREE WATER	THERE SHOULD BE NO FREE WATER	THERE SHOULD BE NO FREE WATER	
	Water (Vapour)	Air for compressed air line breathing apparatus shall have a dewpoint sufficiently low to prevent condensation and freezing. Where apparatus is used and stored at a known temperature pressure dewpoint shall be at least 5°C below the likely lowest temperature. Where conditions of usage and storage of the air is not known the pressure dewpoint shall not exceed -11°C.	4°C (39°F) pdp @ 50psi g	The pressure dewpoint of the compressed breathing air shall be at least 5°C (9°F) below the lowest temperature to which any part of the compressed breathing air pipline or the accepted respirator maybe exposed at any season of the year.	Airline pressure dewpoint should be at least 5°C below the lowest know temperature or -11°C if the lowest temperature is not known.	

©2009 Parker Hannifin Corporation. All rights reserved. Catalogue: 17 400 4436 03/09 Rev. 00



